

Regd. Office & Factory:-
Plot # EL- 215, MIDC, Mahape,
Navi Mumbai - 400 710.
India
admin@hyvaindia.com
www.hyva.com



CIN : U50100MH1996PTC102299
Phone : +91 (0) 22 - 6761 88 88
+91 (0) 22 - 2763 51 85
Fax : +91 (0) 22 - 2767 21 82

HYVA/East/597

April 10, 2019

The Director,
State Urban Development Agency (SUDA),
"ILGUS BHAVAN",
H-C Block, Sector - III,
Bidhannagar, Kolkata - 700 106.



EE (BLP)
SUD C.D. Dr. AE
17/4

Sub : Release of Fund for Spares and Consumables charge for the quarter from April to June '18, July to September '18 and October to December 2018

Ref : Letter of Acceptance Cum Work Order from SUDA vide their letter no

SUDA-217/2015/98 dated 18-01-2016

And Your letter no SUDA/218/2017/785/1(1) dated 13.10.2017

Dear Sir,

This is to inform you that as per the above work order we have been providing our services for Operation and Maintenance and to keep the compactors in working condition we have been carrying out various repair job as when required. Kindly note that while carrying out the repair job we are fixing/replacing spares and consumables as per the requirement of the equipment.

In this respect please note that we have now raised our invoices for Spares and Consumables for the quarter April to June '18, July to September '18 and October to December 2018. The details of invoices raised against each ULB are enclosed for your reference. We are also arranging to submit these invoices to the respective municipalities for processing to release our payment.

* For your reference we are also enclosing copy of the delivery note of each spares duly received by municipality official and also copy of the service report on fitment of spares to the equipment which is also certified by municipality official.

We, therefore, request you to kindly arrange to release the fund as early as possible as per the enclosed statement towards Spare and Consumables for compactors to the respective ULB's so that we can follow up to the ULBs for our payment.

Thanking you and assuring you of our best support,

Yours truly,
For Hyva (India) Pvt Ltd.

AKGhosh
Project Head

Encl: As stated above

Enclosure to the letter no Hyva/East/597 dated 10.04.2019				Invoice from Apr to Jun 2018			Invoice from Jul to Sep 2018			Invoice from Oct to Dec 2018			Grand Total	Fund to be released to ULB
Sl. No.	ULB Name	CHASSIS NO	Zone	Invoice No	Date	Amount	Invoice No	Date	Amount	Invoice No	Date	Amount		
1	Bidhannagar Municipal Corporation	MAT373352G2A02204	I										0.00	0
2	Bidhannagar Municipal Corporation	MAT373352G2A02436	I										0.00	
3	Dumdum Municipality	MAT373352G2A02324	I				11800173	12.12.2018	945.41				945.41	6825
4	Dumdum Municipality	MAT373352G2A02293	I				11800172	12.12.2018	3929.68	11800220	30.12.2018	1950.06	5879.74	
5	South Dum Dum Municipality	MAT373352G2A02369	I				11800155	12.12.2018	945.41				945.41	16697
6	South Dum Dum Municipality	MAT373352G2A02379	I	11800074	19.11.2018	7827.17	11800154	12.12.2018	7924.86				15752.03	
7	Madhyamgram Municipality	MAT373352G2B02601	I	11800075	19.11.2018	2943.04	11800187	13.12.2018	2943.04	11800221	30.12.2018	6637.03	12523.11	15465
8	Madhyamgram Municipality	MAT373352G2A02372	I							11800222	30.12.2018	2942.10	2942.10	
9	Bongaon Municipality	MAT373018G2D10038	I				11800160	12.12.2018	212058.26	11800205	30.12.2018	1861.17	213919.43	217817
10	Bongaon Municipality	MAT373352G2B02579	I	11800082	19.11.2018	3897.47							3897.47	
11	Rajpur Sonarpur Municipality	MAT373352G2B02757	I	11800112	19.11.2018	90985.58	11800165	12.12.2018	3929.68				94915.26	94915
12	Chandannagore Municipal Corporation	MAT373352G2B02819	I	11800120	19.11.2018	3929.68							3929.68	3930
13	Baidyabati Municipality	MAT373352G2B02902	I							11800228	30.12.2018	3088.42	3088.42	6177
14	Baidyabati Municipality	MAT373352G2B02627	I							11800229	30.12.2018	3088.42	3088.42	
15	Uttarpara Kotrung Municipality	MAT373352G2B02828	I				11800164	12.12.2018	3929.68				3929.68	75975
16	Uttarpara Kotrung Municipality	MAT373352G2B02857	I							11800242	30.12.2018	72045.26	72045.26	
17	Kalyani Municipality	MAT373352G2C06805	I	11800083	19.11.2018	2943.04	11800169	12.12.2018	3929.68	11800237	30.12.2018	787.29	7660.01	7660
18	Habra Municipality	MAT373352G2C06801	I	11800081	19.11.2018	3897.47	11800179	12.12.2018	75933.67				79831.14	79831
19	Baranagar Municipality	MAT373352G2C05916	I	11800076	19.11.2018	4778.06	11800153	12.12.2018	122163.09				126941.15	
20	Baranagar Municipality	MAT373352G2C06531	I				11800170	12.12.2018	3929.68				3929.68	132453
21	Baranagar Municipality	MAT457453G7J16521	I							11800236	30.12.2018	1582.28	1582.28	
22	Barasat Municipality	MAT373352G2C07363	I				11800152	12.12.2018	73995.34				73995.34	73995
23	Barrackpore Municipality	MAT373352G2C06766	I	11800077	19.11.2018	3897.49				11800211	30.12.2018	2942.10	6839.59	10769
24	Barrackpore Municipality	MAT373352G2C06765	I				11800174	12.12.2018	3929.68				3929.68	
25	Kamarhati Municipality	MAT373352G2C06806	I							11800208	30.12.2018	2942.10	2942.10	3888
26	Kamarhati Municipality	MAT373352G2C06802	I							11800207	30.12.2018	945.41	945.41	
27	Kanchrapara Municipality	MAT373352G2C06653	I				11800182	13.12.2018	5838.49				5838.49	103821
28	Kanchrapara Municipality	MAT373352G2C07725	I	11800088	19.11.2018	90104.99	11800183	13.12.2018	7877.37				97982.36	
29	North Dum Dum Municipality	MAT373352G2C07548	I				11800197	13.12.2018	3929.68	11800219	30.12.2018	971.78	4901.46	4901
30	Diamond Harbour Municipality	MAT373352G2C06349	I	11800089	19.11.2018	4810.27							4810.27	4810
31	Bhadreswar Municipality	MAT373352G2C07549	I				11800193	13.12.2018	3897.49				3897.49	3897
32	Chandpur Municipality	MAT373352G2C06460	I							11800210	30.12.2018	1004.65	1004.65	1005
33	Sreerampore Municipality	MAT373352G2C07728	I	11800119	19.11.2018	6637.03							6637.03	6637
34	Uluberia Municipality	MAT373352G2C05977	I	11800091	19.11.2018	1004.68							1004.68	1005
35	Sainthia Municipality	MAT373352G2C07083	II				11800200	13.12.2018	3897.49	11800230	30.12.2018	971.78	4869.27	4869
36	Nalhati Municipality	MAT373352G2C06921	II				11800175	12.12.2018	5758.64				5758.64	5759
37	Bankura Municipality	MAT373352G2C06432	II				11800168	12.12.2018	3929.68	11800235	30.12.2018	19024.24	22953.92	22954
38	Purulia Municipality	MAT373352G2C06528	II				11800166	12.12.2018	3929.68				3929.68	5880
39	Purulia Municipality	MAT373352G2C06546	II				11800167	12.12.2018	1950.06				1950.06	
40	Kharagpur Municipality	MAT373352G2C07048	II				11800163	12.12.2018	3929.68	11800233	30.12.2018	971.78	4901.46	4901

[Handwritten signature]

41	Contai Municipality	MAT373352G2C05913	II	11800113	19.11.2018	6674.53				11800232	30.12.2018	971.78	7646.31	7646
42	Haldia Municipality	MAT373352G2C07047	II	11800114	19.11.2018	3722.36	11800171	12.12.2018	4934.33	11800234	30.12.2018	19024.24	27680.93	133974
43	Haldia Municipality	MAT373352G2C07049	II	11800087	19.11.2018	106293.26							106293.26	
44	Gayespur Municipality	MAT373352G2C08069	I										0.00	0
45	Burdwan Municipality	MAT373018G2D08728	II	11800115	19.11.2018	3722.34							3722.34	28330
46	Burdwan Municipality	MAT373018G2D08712	II	11800216	19.11.2018	1861.17				11800215	30.12.2018	22746.60	24607.77	
47	Berhampore Municipality	MAT373018G2D09005	II	11800110	19.11.2018	880.59							880.59	163911
48	Berhampore Municipality	MAT373018G2D08982	II	11800090	19.11.2018	72925.87				11800223	30.12.2018	90104.99	163030.86	
49	Gobardanga Municipality	MAT373018G2D09334	I				11800184	13.12.2018	1004.65	11800212	30.12.2018	2009.30	3013.95	3014
50	Chakdaha Municipality	MAT373018G2D09308	I				11800188	13.12.2018	2943.04	11800214	30.12.2018	1004.65	3947.69	10613
51	Chakdaha Municipality	MAT373018G2D09532	I				11800189	13.12.2018	2943.04	11800213	30.12.2018	3722.36	6665.40	
52	Konnagar Municipality	MAT373018G2D09523	I							11800238	30.12.2018	945.41	945.41	945
53	Hooghly Chinsurah Municipality	MAT373018G2D09546	I				11800186	13.12.2018	1759.07				1759.07	1759
54	Titagarh Municipality	MAT373018G2D09522	I	11800104	19.11.2018	880.59	11800185	13.12.2018	1004.65				1885.24	4657
55	Titagarh Municipality	MAT373018G2D09510	I	11800105	19.11.2018	880.59	11800180	12.12.2018	945.41	11800204	30.12.2018	945.41	2771.41	
56	Rishra Municipality	MAT373018G2D09634	I	11800080	19.11.2018	3897.48				11800225	30.12.2018	6637.03	10534.51	22069
57	Rishra Municipality	MAT373018G2D09635	I				11800192	13.12.2018	6840.53	11800226	30.12.2018	4694.14	11534.67	
58	Budge Budge Municipality	MAT373352G2C06661	I	11800078	19.11.2018	3897.48							3897.48	3897
59	Baduria Municipality	MAT373018G2D09087	I	11800079	19.11.2018	4778.07	11800199	13.12.2018	945.41				5723.48	5723
60	Durgapur Municipal Corporation	MAT373018G2D08780	II	11800084	19.11.2018	880.59	11800176	12.12.2018	1861.17				2741.76	5484
61	Durgapur Municipal Corporation	MAT373018G2D08770	II	11800086	19.11.2018	880.59	11800177	12.12.2018	1861.17				2741.76	
62	Taherpur Municipality	MAT373018G2D09841	I	11800085	19.11.2018	880.59	11800151	12.12.2018	106293.26	11800218	30.12.2018	3722.36	110896.21	110896
63	Dainhat Municipality	MAT373018G2D08984	II	11800092	19.11.2018	880.59							880.59	881
64	Gushkara Municipality	MAT373018G2D09631	II	11800093	19.11.2018	880.59							880.59	881
65	Kalna Municipality	MAT373018G2D08711	II	11800094	19.11.2018	880.59							880.59	881
66	Katwa Municipality	MAT373018G2D08886	II	11800095	19.11.2018	880.59							880.59	881
67	Memari Municipality	MAT373018G2D08893	II	11800096	19.11.2018	880.59							880.59	881
68	Tamluk Municipality	MAT373018G2D08854	II	11800097	19.11.2018	880.59							880.59	881
69	Haringhata Municipality	MAT373352G2C06228	I	11800098	19.11.2018	880.59							880.59	
70	Haringhata Municipality	MAT373352G2C06319	I	11800099	19.11.2018	880.59							880.59	1761
71	Birnagar Municipality	MAT373352G2C08024	I	11800100	19.11.2018	880.59							880.59	881
72	Ranaghat Municipality	MAT373018G2D09333	I	11800101	19.11.2018	880.59							880.59	881
73	North Barrackpore Municipality	MAT373352G2C06919	I	11800102	19.11.2018	880.59	11800156	12.12.2018	10867.90	11800239	30.12.2018	21825.86	33574.35	37398
74	North Barrackpore Municipality	MAT373352G2C06924	I	11800103	19.11.2018	880.59	11800157	12.12.2018	2943.04				3823.63	
75	Basirhat Municipality	MAT373018G2D09750	I	11800106	19.11.2018	880.59				11800227	30.12.2018	1976.43	2857.02	3738
76	Basirhat Municipality	MAT373018G2D09747	I	11800107	19.11.2018	880.59							880.59	
77	Jangipur Municipality	MAT373018G2D09023	II	11800108	19.11.2018	880.59							880.59	1761
78	Jangipur Municipality	MAT373018G2D08916	II	11800109	19.11.2018	880.59							880.59	
79	Panihati Municipality	MAT373352G2A02430	I				11800158	12.12.2018	11720.79				11720.79	122226
80	Panihati Municipality	MAT373352G2A02431	I	11800117	19.11.2018	7582.44	11800159	12.12.2018	4893.10	11800241	30.12.2018	98029.85	110505.39	
81	Beldanga Municipality	MAT373018G2D09126	II	11800118	19.11.2018	1890.80							1890.80	1891
82	Naihati Municipality	MAT373018G2D09782	I				11800161	12.12.2018	3929.68				3929.68	14514
83	Naihati Municipality	MAT373018G2D09838	I				11800162	12.12.2018	9580.05	11800206	30.12.2018	1004.65	10584.70	
84	Asansol Municipality	MAT373018G2D08791	II										0.00	0

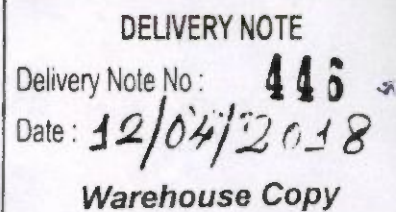
[Handwritten signature]

85	New Barrackpore Municipality	MAT373352GZC07742	I		11800194	13.12.2018	880.59	11800216	30.12.2018	3772.36	4602.95	4603
86	Nabadwip Municipality	MAT373018G2D08983	I		11800195	13.12.2018	3941.31				3941.31	3941
87	Khardah Municipality	MAT373352GZA02437	I		11800196	13.12.2018	2943.04	11800203	30.12.2018	1004.65	3947.69	10761
88	Khardah Municipality	MAT373352GZA02439	I					11800201	30.12.2018	6813.51	6813.51	
89	Panskura Municipality	MAT373018G2D09742	II		11800198	13.12.2018	90104.99				90104.99	90105
90	Gushkara Municipality	MAT373018G2D09631	II								0.00	0
91	Taki Municipality	MAT373018G2D09133	I					11800217	30.12.2018	1004.65	1004.65	1005
92	Coopers Camp Municipality	MAT373018G2D09846	I		11800111	19.11.2018	11368.31				11368.31	11368
				Total	475543.06			Total		415666.10	1731874.80	1731875
							840565.64		Total			17.32


PARTS INVOICING FOR THE QUARTER APR'18 TO JUN'18 AS PER THE FOLLOWING DETAILS:


SL. NO.	ULB NAME	CHASSIS NO.	PART NO.	DESCRIPTION	QTY.	DELIVERY NOTE NO.
1	South Dum Municipality	MAT373352G2A02379	5739980177	ACCEL CTRL MECH MANUAL 3 M	1	446
2	Madhyamgram Municipality	MAT373352G2B02601	57GC981819	HOSE 1"IDX1500L POWERFLEX	1	527
3	Baranagar Municipality	MAT373352G2C05916	5603200306	REAR DOOR SEALING RUBBER	7	471
4	Barrackpore Municipality	MAT373352G2C06766	5739980177	ACCEL CTRL MECH MANUAL 3 M	1	448
5	Budge Budge Municipality	MAT373352G2C06661	14896991A	RLF ELEMENT	1	145
6	Baduria Municipality	MAT373018G2D09087	8102117	AIR BREATHER FILTER ELEMENT	1	145
7	Rishra Municipality	MAT373018G2D09634	5739980177	ACCEL CTRL MECH MANUAL 3 M	1	449
8	Habra Municipality	MAT373352G2C06801	5739980177	ACCEL CTRL MECH MANUAL 3 M	1	450
9	Bongaon Municipality	MAT373352G2B02579	5739980177	ACCEL CTRL MECH MANUAL 3 M	1	452
10	Kalyani Municipality	MAT373352G2C06805	5603200306	REAR DOOR SEALING RUBBER	7	457
11	Durgapur Municipal Corporation	MAT373018G2D08780	14896991A	RLF ELEMENT	1	171
12	Durgapur Municipal Corporation	MAT373018G2D08770	8102117	AIR BREATHER FILTER ELEMENT	1	172
13	Taherpur Municipality	MAT373018G2D09841	14896991A	RLF ELEMENT	1	316
14	Haldia Municipality	MAT373352G2C07049	8102117	AIR BREATHER FILTER ELEMENT	1	462
15	Kanchrapara Municipality	MAT373352G2C07725	56211172	EJECTOR CYLINDER RCB1314	1	463
16	Diamond Harbour Municipality	MAT373352G2C06349	57GC983197	MINI/MEDIUM/MEGA FRONT VALVE	1	469
17	Berhampore Municipality	MAT373018G2D08982	57GC981819	PUMP VANE DOUBLE-63/21CC/REV R	1	519
18	Berhampore Municipality	MAT373018G2D09005	14896991A	RLF ELEMENT	1	476
19	Uluberia Municipality	MAT373352G2C05977	8102117	AIR BREATHER FILTER ELEMENT	1	349
20	Dainhat Municipality	MAT373018G2D08984	14896991A	AIR BREATHER FILTER ELEMENT	1	348
21	Gushkara Municipality	MAT373018G2D09631	8102117	HANDLE LEVER ASSY	2	478
22	Kalna Municipality	MAT373018G2D08711	14896991A	RLF ELEMENT	1	173
23	Katwa Municipality	MAT373018G2D08886	8102117	AIR BREATHER FILTER ELEMENT	1	174
				RLF ELEMENT	1	175
				AIR BREATHER FILTER ELEMENT	1	176

[Handwritten signature]



SOUTH DUMDUM MUNICIPALITY
CHASSIS NO: 1
DATE: 26.12.2023

S. Sinha Roy (Warehouse in charge) Date : <u>12/04/2018</u>	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition  (Receiver's Signature) Date : <u>12/04/18</u>
---	---	--

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1SDUM011	SERVICE REPORT				12.04.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/446
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2A02379
Customer' Address	Site Address				Body Sl. No.	02VHPC01-008
South Dum Dum Municipality	South Dum Dum Municipality				Model/	RCV1314
					Delivery Date	05-03-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Accelerator Cable found defect						
Job Done & Recommendation						
Replace - 1pc (part no - 5739980177)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1SDUM0011	SERVICE REPORT				27.06.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-527
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2A02379
Mr. Dayal Mahato					Body Sl. No.	02VHPC01-008
Customer' Address	Site Address				Model/	RCV1314
South Dum Dum Municipality (North 24th Parganas)	South Dum Dum Municipality North 24th Parganas)				Delivery Date	05-03-2016
					Failure Date	
Type of Visit	Type of Job					
☒ On Call ☐ On Own ☐ [1] Commissioning ☒ [2] Warranty ☐ [3] Chargeable ☐ [4] Campaign						
Nature of Complaints & Failure Analysis						
Hose fault arise.						
Job Done & Recommendation						
Replaced Hose 57GC981819 - 1pc						
Status of Vehicle after visit						
☒ [1] Break Down ☐ [2] Working with Defect ☒ [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

DELIVERY NOTE
Delivery Note No : **471**
Date : **16/05/2018**
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	Made of Transport : <i>By HAND</i>
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	<i>THE CHARMAN</i> <i>MADHYAMGRAM MUNICIPALITY</i> <i>CHASSIS NO:</i> <i>MAT373352G2B02601</i>	

[illegible]

VAT NO : 19714219085
TIN NO : 19714219085
CST NO : 19714219085

Receive the above in good condition

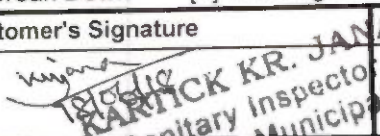
(Receiver's Signature)

Date :

S. Srinivas Rao
(Warehouse in-charge)
Date: 18/05/2018

HIPL/CR/09/03	Hyva (India) Pvt. Ltd.					
Code: ZIMADH016	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-
Mr. Dayal Mahato	Date	Time	Date	Time	Chassis Nos.	JMAT 37 335292802601
Customer' Address	Site Address				Body Sl. No.	03VHP01-012
	The chair mon Kachhyom. gram.				Model/	RCV1314
Type of Visit	Type of Job				Delivery Date	16/5/2018
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign				Failure Date	16/5/2018
Nature of Complaints & Failure Analysis						
Damage - tail gate Rubber.						
Job Done & Recommendation						
Replaced . Rear Door Ceiling Rubber. 5603200306.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



LIQR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BRAN043	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/448
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373352G2C05916
Customer' Address	Site Address				Body Sl. No.	03VHPC01-053
					Model/	RCV 1314
Baranagar Municipality, 87, Deshbandhu Road, P.O. Alambazar, 24 Parganas (N), Kolkata-700 035	Baranagar Municipality, 87, Deshbandhu Road, P.O. Alambazar, 24 Parganas (N), Kolkata-700 035				Delivery Date	11-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Fault Arrise in Accelator Cable						
Job Done & Recommendation						
Replaced New ACCEL CTRL MECH MANUAL - 1pc (Part code 5739980177)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature				Customer's Remarks		
 KARNICK KR. JANA Sanitary Inspector Baranagar Municipality						
Service Engineer's Signature		Warranty Claim No.		Offer No./Proforma Invoice No.		
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

Sanitary Inspector
Baranagar Municipality

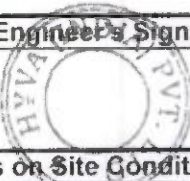
DELIVERY NOTE
Delivery Note No : **449**
Date : **12/04/2018**
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	Made of Transport :
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN BARRACKPORE MUNICIPALITY CHASSIS NO: MAT373352G2C06766	By HAND

[illegible]

S. Simha Roy (Warehouse in-charge) Date : 12/04/2018	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition  (Receiver's Signature) Date : 22/06/18
---	---	--

[illegible]

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BUDG059	SERVICE REPORT				12/04/2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/450
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2C06661
Mr. Dayal Mahato					Body Sl. No.	03VHPC01-056
Customer' Address	Site Address				Model/	RCV1314
Budge Budge Municipality (South 24th Parganas)	Budge Budge Municipality (South 24th Parganas)				Delivery Date	11-04-2016
					Failure Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Fault arise in Accelator Cable						
Job Done & Recommendation						
Replace Cable - 1pc (5739980177)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
			Satisfied			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
					Con. : 1000 Budge Budge Municipality	
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

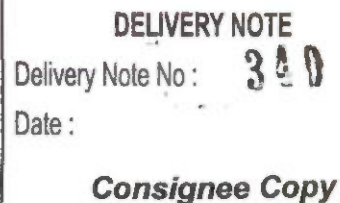
DELIVERY NOTE
Delivery Note No : **452**
Date : **12/04/2018**
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN BADURJA MUNICIPALITY CHASSIS NO: MAT373018G2D09087	Made of Transport : By HAND


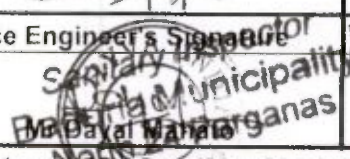
[illegible]

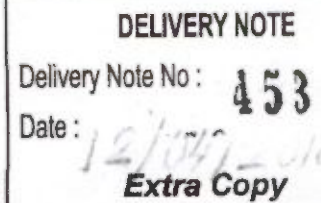
S. Sinha Roy (Warehouse in-charge) Date : 12/04/2018	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition <i>[Signature]</i> 13/04/2018 (Receiver's Signature) Sanitary Inspector Date: Baduria Municipality North 24 Parganas
--	---	--

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BADU151	SERVICE REPORT				12.04.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/452
	Date	Time	Date	Time	Chassis Nos.	MAT373018G2D09087
Customer' Address	Site Address				Body Sl. No.	04VHPC01-150
					Model/	RCV1314
Baduria Municipality	Baduria Municipality				Delivery Date	07-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Accelerator Cable found defect						
Job Done & Recommendation						
Replace Hose - 1pc (part no - 5739980177)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Baduria Municipality North 24 Parganas						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



By HAND

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BADU151	SERVICE REPORT				Date : 13/04/2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/581
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D09087
Customer' Address	Site Address				Body Sl. No.	04VHPC01-150
					Model/	RCV 1314
Baduria Municipality, P.O. Baduria, 24Parganas (N)- 743401	Baduria Municipality, P.O. Baduria, 24 Parganas (N)- 743401				Delivery Date	07-05-2016
					Service Date	13/04/2018
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
			Hydraulic oil given by Municipality			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



RASIRA MUNICIPALITY
CHASSIS NO:
MAT57301262DD9684

By HAND

Received
Banki
25/9/18
Unter Vorbehalt der Nach-
richte Monarchie

Receive the above in good condition

(Receiver's Signature)

Date :

Annexure III

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1RISH171	SERVICE REPORT				12.04.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/453
	Date	Time	Date	Time	Chassis Nos.	MAT373018G2D09634
					Body Sl. No.	05VHPC01-160
Customer' Address	Site Address				Model/	RCV1314
Rishra Municipality	Rishra Municipality				Delivery Date	13-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Accelerator Cable found defect						
Job Done & Recommendation						
Replace Hose - 1pc (part no - 5739980177)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Motor Vehicles Incharge Rishra Municipality						

DELIVERY NOTE
Delivery Note No : **454**
Date :
Extra Copy

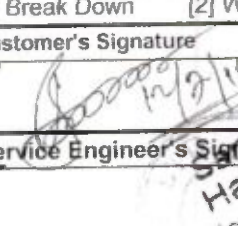
DEPOT ADDRESS	DELIVERY ADDRESS	Made of Transport :
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN HADRA MUNICIPALITY CHASSIS NO - MAT 373959G2006801	

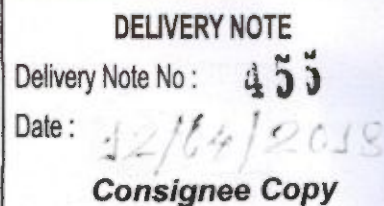
[illegible]

(Warehouse in-charge)	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition (Receiver's Signature) Date :
------------------------------	---	--

Copy Distribution

1st Copy : Customer 2nd Copy : Myva-Area Manager 3rd Copy : _____ py . Dealer

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1HABR041	SERVICE REPORT				12.04.2018	
Visited By	From Date		To Date		Call Log No.	HIPL/KOL/2018/SR/DM/454
					Chassis Nos.	MAT373352G2C06801
					Body Sl. No.	03VHPC01-057
Customer' Address	Site Address				Model/	RCV1314
Habra Municipality	Habra Municipality				Delivery Date	11-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Accelerator Cable damage						
Job Done & Recommendation						
Replaced Accelerator Cable - 01 pc (part number 5739980177)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature				Customer's Remarks		
 Service Engineer's Signature Habra Municipality North 24 Parganas (W.B.)				Warranty Claim No.		
				Offer No./Proforma Invoice No.		
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



THE CHALK MAN
BONGAON NONO PALITY
CHASSIS NO.
MAT373352G2B1254

By Paul

Date :



Annexure III

Hyva (India) Pvt. Ltd.



12.04.2018

SERVICE REPORT

Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/455
	Date	Time	Date	Time		
					Chassis Nos.	MAT373352G2B02579
					Body Sl. No.	03VHPC01-014
Customer' Address	Site Address				Model/	RCV1314
Bongaon Municipality	Bongaon Municipality				Delivery Date	29-03-2016
					Service Date	

Type of Visit	Type of Job
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign

Nature of Complaints & Failure Analysis

Accelerator Cable damage

Job Done & Recommendation

Replaced Accelerator Cable - 01 pc (part number 5739980177)

Status of Vehicle after visit

[1] Break Down [2] Working with Defect [3] Working Satisfactory

Customer's Signature	Customer's Remarks	
Service Engineer's Signature	Warranty Claim No.	Offer No./Proforma Invoice No.

Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices

Copy Distribution

1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer

Annexure III



HYVA (INDIA) PVT LTD
PLOT NO - EL 215,
MIDC, MAHAPE
NAVI MUMBAI - 400 710
CIN : U50100MH1996PTC102299

DELIVERY NOTE
Delivery Note No : **171**
Date :
Consignee Copy

DEPOT ADDRESS

HYVA (INDIA) PVT LTD
NH - 6, Chamrail, Kona ,
PO - Lakhshmanpur,
Dist - Howrah - 711 114

DELIVERY ADDRESS

THE COMMISSIONER
DURGAPUR MUNICIPAL
CORPORATION
CHASSIS NO:
MAT37301892008780

Made of Transport :

By HAND

Sl No.	Description	Part Number	Qty Issued	Qty Utilised	Qty Returned
1.	RETURN LINE FILTER ELEMENT	14896991A	01		
2.	BREATHER ELEMENT	0810211Z	01		

S. Sinha Roy
(Warehouse in-charge)

Date :

VAT NO : 19714219085

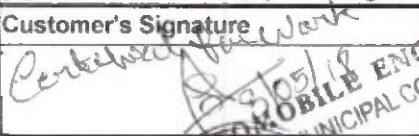
TIN NO : 19714219085

CST NO : 19714219085

Receive the above in good condition

(Receiver's Signature)

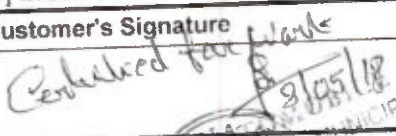
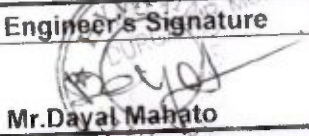
Date

JQR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z2DURG122	SERVICE REPORT				Date : 20.09.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/635
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D08780
Customer' Address	Site Address				Body Sl. No.	04VHPC01-118
					Model/	RCV 1314
Durgapur Municipal Corporation, Durgapur City Centre, P.O. Durgapur, Dist. Burdwan-713216	Durgapur Municipal Corporation, Durgapur City Centre, P.O. Durgapur, Dist. Burdwan-713216				Delivery Date	29-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

DELIVERY NOTE
Delivery Note No : **172**
Date :
Consignee Copy

[illegible]

<i>S. Simha Roy</i> (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition (Receiver's Signature) Date :
--	---	--

PLIQR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z2DURG123	SERVICE REPORT				Date : 24.09.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/636
Mr. Dayal Mahato	Date	Time	Date	Time	Chassis Nos.	MAT373018G2D08770
					Body Sl. No.	04VHPC01-119
Customer' Address	Site Address				Model/	RCV 1314
Durgapur Municipal Corporation, Durgapur City Centre, P.O. Durgapur, Dist. Burdwan-713216	Durgapur Municipal Corporation, Durgapur City Centre, P.O. Durgapur, Dist. Burdwan-713216				Delivery Date	29-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature		Customer's Remarks				
						
Service Engineer's Signature		Warranty Claim No.		Offer No./Proforma Invoice No.		
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

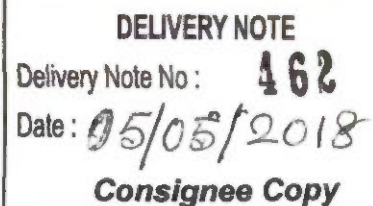
DELIVERY NOTE
Delivery Note No : **316**
Date :
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN TAHERPUR MUNICIPALITY CHASSIS NO: MAT373018G2D09841	Made of Transport : By HAND

[illegible]

<i>S. Sinha Roy</i> (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST.NO : 19714219085	Receive the above in good condition <i>Singh Roy</i> (Receiver's Signature) Date :
--	---	---

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.				HYVA	
Code: Z1TAHE178	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/717
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D09841
Customer' Address	Site Address				Body Sl. No.	05VHPC01-179
					Model/	RCV 1314
Taherpur Notified Area, P.O.Taherpur, Dist. Nadia-741159	Taherpur Notified Area, P.O.Taherpur, Dist. Nadia-741159				Delivery Date	16-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature	Customer's Remarks					
Service Engineer's Signature	Warranty Claim No.	Offer No./Proforma Invoice No.				
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						



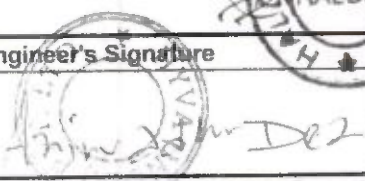
THE CHAIRMAN
HALDIA MUNICIPALITY
CHASSIS NO:
MAT373352G2C07049

By VEHICLE NO:
WB11D-0313

08/03/18

Date :

Annexure III

LQR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z2HALD090	SERVICE REPORT				05.05.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/462
	Date	Time	Date	Time		
					Chassis Nos.	MAT373352G2C07049
					Body Sl. No.	04VHPC01-103
Customer' Address	Site Address				Model/	RCV1314
Haldia Municipality	Haldia Municipality				Delivery Date	30-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Eject Plate not working						
Job Done & Recommendation						
Replaced Eject Cylinder -1pc (Part number 56211172) and Mini/ Medium/ Mega front valve -01pc (Part number 57GC983197)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature				Customer's Remarks		
Service Engineer's Signature		Warranty Claim No.		Offer No./Proforma Invoice No.		
						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

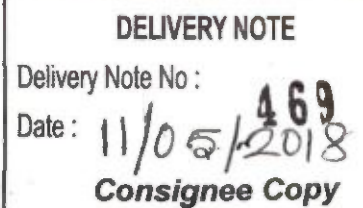
[illegible]

Code - ZIKANC052

30/05/18

HIPL/QR/09/04	Hyva (India) Pvt. Ltd.				HYVA
Service Report:		SERVICE REPORT			
Visited By	From		To		Call Log No.
	Date	Time	Date	Time	
					Veh. Chassis Nos. MAT373352/2 C07925
Customer's Address	Site Address				Compactor Type,
					Capacity, Part No
Kanchrapara Municipality 24th Pgs (N)	Kanchrapara Municipality 24th Pgs (N)				Compactor Sl. Nos.
					Delivery Date
					Commissioning Date
Type of Visit	Type of Job				
1) On Call 2) On Ow	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign				
Nature of Complaints & Failure Analysis (use additional sheet for observations if required)					
Fault found from pump valve double.					
Job Done & Recommendation					
Replace new One. pump valve double (part No - 576C931975)					
Status of Vehicle after visit					
[1] Break Down [2] Working with Defect [3] Working Satisfactory					
Customer's Signature & Stamp				Customer's Remarks	
Service Engineer's Signature				Warranty Claim No. (if raised)	
(Hyva India Pvt. Ltd.)				Offer No. / Proforma Invoice No.	
Remarks on Site Condition / Vehicle Operation / Maintenance Practices / Loading Practices					
Copy Distribution					
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer					
Annexure III					

Pankh
30/5/18




THE CHAIRMAN
DIAMOND HARBOUR
MUNICIPALITY
CHASSIS NO:
MAT373352G2C06349

By HAND



<i>S. Simha Roy</i> (Warehouse in-charge) Date : 11/05/2018	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition <i>Sankar</i> 29/05/2018 (Receiver's Signature) Sub-Assistant Engineer Date : Diamond Harbour Municipality
--	---	---

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1DIAM058	SERVICE REPORT				11.05.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/469
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2C06349
					Body Sl. No.	03VHPC01-050
Customer' Address	Site Address				Model/	RCV1314
Diamond Harbour Municipality	Diamond Harbour Municipality				Delivery Date	09-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature				Customer's Remarks		
Service Engineer's Signature				Warranty Claim No.		Offer No./Proforma Invoice No.
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						




HIPL/QR/09/03	Hyva (India) Pvt. Ltd.				HYVA	
Code: 21DIAM058	SERVICE REPORT				Date : 14/06/2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-519
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MA93733526206349
Customer' Address	Site Address				Body Sl. No.	
Diamond Harbour Municipality	Diamond Harbour Municipality				Model/	RCV1314
					Delivery Date	
					Failure Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Bjeer van to PTO pump those Licheye.						
Job Done & Recommendation						
New Replum. Part no. 5746981813 - 51 p.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

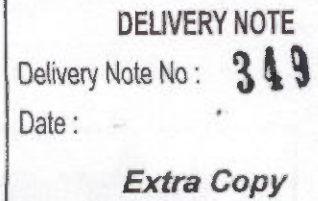
13.7.18.

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.				HYVA	
Code: Z2BERH127	SERVICE REPORT				21.05.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/476
	Date	Time	Date	Time	Chassis Nos.	MAT373018G2D08982
RAMPRASAD DAS	21.5.18	0 am	21.5.18	5 pm	Body Sl. No.	04VHPC01-126
Customer' Address	Site Address				Model/	RCV1314
Berhampore Municipality	Berhampore Municipality				Delivery Date	30-04-2016
					Service Date	21-5-18
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Eject Plate not working						
Job Done & Recommendation						
Replaced Eject Cylinder -1pc (Part number 56211172)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
 Vice-Chairman Berhampore Municipality						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Ramprasad Das						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

Annexure III

work has been done.


13.7.18.
Sundar Inspector
Berhampore Municipality



Made of Transport :

THE CHAIRMAN
DORHAMPTON MUNICIPALITY
UNLESS NO:
MAT373012G2D08982

BY HAND

<i>S. Sinha Roy</i> (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition <i>[Signature]</i> (Receiver's Signature) Date : 16-5-18
--	---	---

Annexure III

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.	
Code: Z2BERH127	SERVICE REPORT	Date : 16-5-18

Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/599
	Date	Time	Date	Time		
Mr. Dayal Mahato	16-5-18	12:30 pm	16-5-18	2:00 pm	Chassis Nos.	MAT373018G2D08982
					Body Sl. No.	04VHPC01-126
Customer' Address	Site Address				Model/	RCV 1314
Berhampore Municipality, P.O. Berhampore, Murshidabad-742101	Berhampore Municipality, P.O. Berhampore, Murshidabad-742101				Delivery Date	30-04-2016
					Service Date	

Type of Visit	Type of Job
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign

Nature of Complaints & Failure Analysis

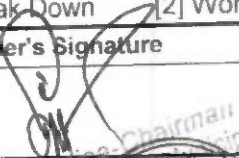
Hydraulic Maintenance of RCB movable compactor

Job Done & Recommendation

Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.

Status of Vehicle after visit

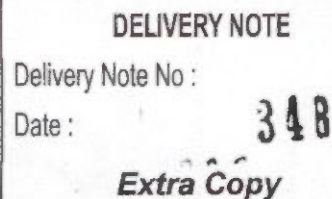
[1] Break Down [2] Working with Defect [3] **Working Satisfactory**

Customer's Signature	Customer's Remarks	
	100L Hydraulic oil supplied by municipality	
Service Engineer's Signature	Warranty Claim No.	Offer No./Proforma Invoice No.
Mr. Dayal Mahato		

Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices

Copy Distribution

1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer



THE CHAKMANT
SERIAMPORE MUNICIPALITY
CLASS'S NO:
MAT373018G2D0900E

By HAND

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.				HYVA	
Code: Z2BERH126	SERVICE REPORT				Date : 16-5-18	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/598
	Date	Time	Date	Time		
Mr. Dayal Mahato	16-5-18	2:40pm	16-5-18	3:30pm	Chassis Nos.	MAT373018G2D09005
Customer' Address	Site Address				Body Sl. No.	04VHPC01-138
					Model/	RCV 1314
Berhampore Municipality, P.O. Berhampore, Murshidabad-742101	Berhampore Municipality, P.O. Berhampore, Murshidabad-742101				Delivery Date	06-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature			Customer's Remarks			
			100LT Hydraulic oil supplied by municipality			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

DELIVERY NOTE
Delivery Note No : **478**
Date : **31/05/2018**
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	Made of Transport : By HAND
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN ULUBERIA MUNICIPALITY CHASSIS NO: MAT373352G2C05977	

[illegible]

S. Sinha Roy (Warehouse in-charge) Date: 31/05/2018	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition (Receiver's Signature) Date: 31/05/2018
--	---	---

Hyva (India) Pvt. Ltd.



21ULVB071

SERVICE REPORT

Date : 31/05/2018

Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/478
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT3783S2G2C05977
Customer' Address	Site Address				Body Sl. No.	
					Model/	RCV1314
ULUBERIA MUNICIPALITY (Honnah)	ULUBERIA MUNICIPALITY (Honnah)				Delivery Date	
					Failure Date	

Type of Visit	Type of Job
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign	

Nature of Complaints & Failure Analysis

BROKEN HANDLE LEVER ASSY.

Job Done & Recommendation

Replaced New (01 pair) Partcode - 57GC98A396.
02 pcs.

Status of Vehicle after visit

[1] Break Down [2] Working with Defect [3] Working Satisfactory

Customer's Signature	Customer's Remarks

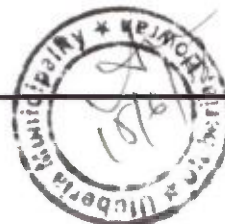
Service Engineer's Signature	Warranty Claim No.	Offer No./Proforma Invoice No.
Mr. Dayal Mahato		

Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices

Copy Distribution

1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer

Annexure III



1/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z2DAIN130	SERVICE REPORT				Date :	
Visited By	From Date Time		To Date Time		Call Log No.	HIPL/KOL/2017/SR/DM/625
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D08984
Customer' Address	Site Address				Body Sl. No.	04VHPC01-130
Dainhat Municipality, Kalna-Katwa Road, P.O. Dainhat, Burdwan-713502	Dainhat Municipality, Kalna-Katwa Road, P.O. Dainhat, Burdwan-713502				Model/	RCV 1314
					Delivery Date	05-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature				Customer's Remarks		
						
Service Engineer's Signature				Warranty Claim No.	Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

DELIVERY NOTE
Delivery Note No : **171**
Date : .
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	Made of Transport : By HAND
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN GUSHKARA MUNICIPALITY CHASSIS NO: MAT373018G2D09631	

[illegible]

S. Sinha Roy (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST.NO : 19714219085	Receive the above in good condition (Receiver's Signature) Date : 25/5/18 
---	---	--





Made of Transport :

By HAND


<i>S. Sinha Roy</i> (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition <i>26/11/18</i> (Receiver's Signature) Date : 
--	---	---


Annexure III

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z2KATW107	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/666
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D08886
Customer' Address	Site Address				Body Sl. No.	04VHPC01-121
					Model/	RCV 1314
Katwa Municipality, Dak- Bunglow Road, P.O. Katwa, Burdwan -713130	Katwa Municipality, Dak- Bunglow Road, P.O. Katwa, Burdwan -713130				Delivery Date	30-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



Made of Transport :
By HAND

S. Sinha Roy (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST,NO : 19714219085	Receive the above in good condition  (Receiver's Signature) Date :
---	---	--

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z2MEMA108	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/680
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D08893
Customer' Address	Site Address				Body Sl. No.	04VHPC01-127
Memari Municipality, P.O. Memari, Burdwan-713146	Memari Municipality, P.O. Memari, Burdwan-713146				Model/	RCV 1314
					Delivery Date	30-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

DELIVERY NOTE


Delivery Note No : **212**

Date : ..

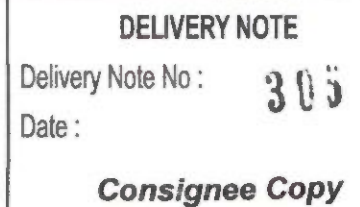
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN TAMLUK MUNICIPALITY CHASSIS NO: MAT3T3018G2D08854	Made of Transport : <i>By HAND</i>

[illegible]

S. Sinha Roy (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST.NO : 19714219085	Receive the above in good condition  5.9- (Receiver's Signature) Date : 20.10.2018
---	---	---


1st Copy : Customer 2nd Copy : Nywa-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer



THE CHAIRMAN
HARINGHATA MUNICIPALITY
CHASSIS NO:
MAT3E3352G2C06228

By HAND

Annexure III

LIQR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BIRN100	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/605
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373352G2C08024
Customer' Address	Site Address				Body Sl. No.	04VHPC01-098
Birnagar Municipality, 151,Barhampore Road, P.O. Birnagar, Nadia-741127	Birnagar Municipality, 151,Barhampore Road, P.O. Birnagar,Nadia-741127				Model/	RCV 1314
					Delivery Date	28-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



DELIVERY NOTE
Delivery Note No : **311**
Date :
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	Made of Transport : By HAND
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN RANAGHAT MUNICIPALITY CHASSIS NO: MAT373058G2D09333	

[illegible]

<i>S. Simha Roy</i> (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST.NO : 19714219085	Receive the above in good condition <i>[Signature]</i> (Receiver's Signature) Date :
--	---	---

1st Copy : Area manager 3rd Copy : Service Engg 4th Copy : Dealer


HIPL/KOL/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1RANA144	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/705
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D09333
Customer' Address	Site Address				Body Sl. No.	04VHPC01-156
					Model/	RCV 1314
Ranaghat Municipality, P.O.Ranaghat, Nadia-744205	Ranaghat Municipality, P.O.Ranaghat, Nadia-744205				Delivery Date	13-05-2016
					Service Date	
Type of Visit		Type of Job				
[1] On Call [2] On Own		[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign				
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

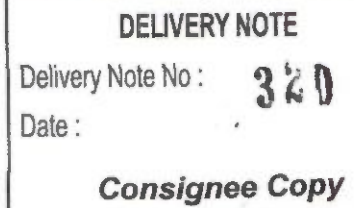
DELIVERY NOTE
Delivery Note No : **319**
Date :
Consignee Copy

DEPOT ADDRESS	DELIVERY ADDRESS	Made of Transport : By HAND
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114	THE CHAIRMAN NORTH BARRACKPORE MUNICIPALITY CHASSIS NO: MAT373352G2C06919	

[illegible]

S. Sinha Roy (Warehouse in-charge)	VAT NO : 19714219085 TIN NO : 19714219085 CST.NO : 19714219085	Receive the above in good condition 22.6.18 S. Sinha Roy Kasturba Municipality (Receiver's Signature)
Date :		Date :

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1NOBA054	SERVICE REPORT				Date :	
Visited By	From Date Time		To Date Time		Call Log No.	HIPL/KOL/2017/SR/DM/690
Mr. Dayal Mahato					Chassis Nos.	MAT373352G2C06919
Customer' Address	Site Address				Body Sl. No.	04VHPC01-066
North Barrackpore Municipality, 375, B.T.Road, P.O. Barrackpore, 24- Parganas(N)-743101	North Barrackpore Municipality, 375, B.T.Road, P.O. Barrackpore, 24- Parganas(N) - 743101.				Model/	RCV 1314
					Delivery Date	16-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature  25.6.18 Sanjay Kumar North Barrackpore Municipality			Customer's Remarks			
Service Engineer's Signature Mr. Dayal Mahato			Warranty Claim No.		Offer No./Proforma Invoice No.	
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



By HAND

Receive the above in good condition

25.6.18



Secretary

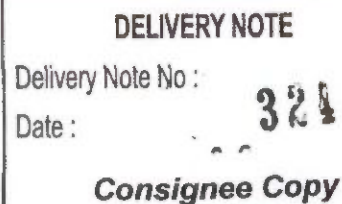
North Barrackpore Municipality

(Receiver's Signature)

Date :


Annexure III


HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1NOBA055	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/691
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373352G2C06924
Customer' Address	Site Address				Body Sl. No.	04VHPC01-070
					Model/	RCV 1314
North Barrackpore Municipality, 375, B.T.Road, P.O. Barrackpore, 24- Parganas(N)-743101	North Barrackpore Municipality, 375, B.T.Road, P.O. Barrackpore, 24- Parganas(N) - 743101.				Delivery Date	16-04-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature			Customer's Remarks			
 Sanjay Sanitary Inspector North Barrackpore Municipality						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						





THE CHAIRMAN
TITAGARH MUNICIPALITY
CHASSIS NO:
MAT373018G2D09522



By HAND

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1TITA159	SERVICE REPORT				Date :	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/722
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D09522
Customer' Address	Site Address				Body Sl. No.	05VHPC01-169
					Model/	RCV 1314
Titagarh Municipality, 1, B.T. Road, P.O. Titagarh, 24-Parganas (N)-743188	Titagarh Municipality, 1, B.T. Road, P.O. Titagarh, 24-Parganas (N)-743188				Delivery Date	14-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature		Customer's Remarks				
						
Service Engineer's Signature		Warranty Claim No.		Offer No./Proforma Invoice No.		
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

		HYVA (INDIA) PVT LTD PLOT NO - EL 215, MIDC, MAHAPE NAVI MUMBAI - 400 710 CIN : U50100MH1996PTC102299		DELIVERY NOTE Delivery Note No : 323 Date : Consignee Copy	
DEPOT ADDRESS		DELIVERY ADDRESS		Made of Transport : By HAND	
HYVA (INDIA) PVT LTD NH - 6, Chamrail, Kona , PO - Lakhshmanpur, Dist - Howrah - 711 114		THE CHAIRMAN TITAGARH MUNICIPALITY CHASSIS NO: MAT373018G2D09510			
Sl No.	Description	Part Number	Qty Issued	Qty Utilised	Qty Returned
1.	RETURN LINE FILTER ELEMENT	14896991A	01		
2.	BREATHER ELEMENT	0810211Z	01		
S. Sinha Roy (Warehouse in-charge) Date :		VAT NO : 19714219085 TIN NO : 19714219085 CST, NO : 19714219085		Receive the above in good condition  (Receiver's Signature) Date :	

PL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1TITA158	SERVICE REPORT				Date :	
Visited By	From		To		Call Log	HIPL/KOL/2017/SR/DM/721
	Date	Time	Date	Time	Als.	
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D09510
Customer' Address	Site Address				Body Sl. No.	05VHPC01-168
					Model/	RCV 1314
Titagarh Municipality, 1, B.T. Road, P.O. Titagarh, 24-Parganas (N)-743188	Titagarh Municipality, 1, B.T. Road, P.O. Titagarh, 24-Parganas (N)-743188				Delivery Date	13-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature		Customer's Remarks				
						
Service Engineer's Signature		Warranty Claim No.		Offer No./Proforma Invoice No.		
						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



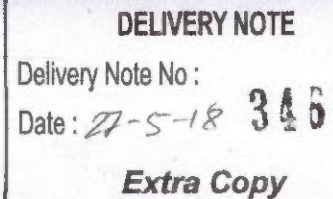
HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BAS1165	SERVICE REPORT				Date :	
Visited By	From Date Time		To Date Time		Call Log No.	HIPL/KOL/2017/SR/DM/595
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D09750
Customer' Address	Site Address				Body Sl. No.	05VHPC01-164
Basirhat Municipality, 55, Sahid Dinesh Mazumdar Road, 24 PGS.(N)-743411	Basirhat Municipality, 55, Sahid Dinesh Mazumdar Road, 24 PGS.(N)-743411				Model/	RCV 1314
					Delivery Date	13-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

DELIVERY NOTE
Delivery Note No : **343**
Date :
Consignee Copy



[illegible]

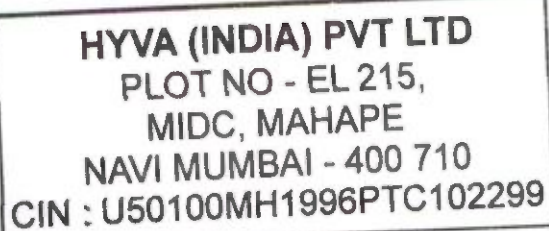
<i>S. Sinha Roy</i> (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition <i>(Signature)</i> (Receiver's Signature) Date :
--	---	---

1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer



By HAND

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z2JANG124	SERVICE REPORT				Date : 27-5-18	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/652
Mr. Dayal Mahato	Date	Time	Date	Time	Chassis Nos.	MAT373018G2D09023
	27-5-18	7:30am	27-5-18	9:30am		
Customer' Address	Site Address				Body Sl. No.	04VHPC01-132
Jangipur Municipality, Pukurtala Road, P.O. Raghunathganj, Murshidabad-742225	Jangipur Municipality, Pukurtala Road, P.O. Raghunathganj, Murshidabad-742225				Model/	RCV 1314
					Delivery Date	05-05-2016
					Service Date	
Type of Visit		Type of Job				
[1] On Call [2] On Own		[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign				
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
 28/5/18 SANITARY INSPECTOR Jangipur Municipality			100L 68 grade Hydraulic oil supplied by Municipality			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



Delivery Note No :

483

Date: 07/06/2018

Consignee Copy

DEPOT ADDRESS

DELIVERY ADDRESS

HYVA (INDIA) PVT LTD

NH - 6, Chamrail, Kona,
PO - Lakhshmanpur,
Dist - Howrah - 711 114

COOPERS CAMP MUNICIPALITY
THE CHAIRMAN
CHASSIS NO:
MAT3T3018G2D09846

Made of Transport :

By HAND

Account
Carbon-copy
of
08/06/18

S. Sinha Roy
(Warehouse in-charge)

Date : 07/06/2018

VAT NO : 19714219085

TIN NO : 19714219085

CST.NO : 19714219085

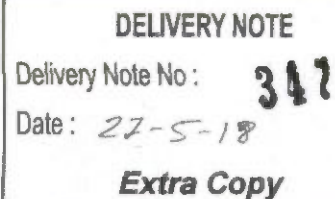
Receive the above in good condition

(Receiver's Signature)

Date : _____

Receiver's Signature

28/06/18



THE CHAIRMAN
JANGI PUR MUNICI PALTY
CHASS'S NO:
MATGY301852DO 8916

Joy HAND

S. Simha Roy (Warehouse in-charge) Date :	VAT NO : 19714219085 TIN NO : 19714219085 CST NO : 19714219085	Receive the above in good condition <i>S. Simha Roy</i> SANITARY INSPECTOR (Receiver's Signature) Date : 28/05/18
---	---	--

Annexure III

PL/QR/09/03	Hyva (India) Pvt. Ltd.				HYVA	
Code: Z2JANG125	SERVICE REPORT				Date : 27-5-18	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/653
	Date	Time	Date	Time		
Mr. Dayal Mahato	27-5-18	9:30 AM	27-8-17	11:30 AM	Chassis Nos.	MAT373018G2D08916
Customer' Address	Site Address				Body Sl. No.	04VHPC01-129
Jangipur Municipality, Pukurtala Road, P.O. Raghunathganj, Murshidabad-742225	Jangipur Municipality, Pukurtala Road, P.O. Raghunathganj, Murshidabad-742225				Model/	RCV 1314
					Delivery Date	05-05-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] <u>Warranty</u> [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic Maintenance of RCB movable compactor						
Job Done & Recommendation						
Drained the full hydraulic oil from the tank and refilled fresh and new hydraulic oil of grade HLP 68. Replaced the return line filter element under part no. 14896991A and also replaced the breather element under part no. 08102117. Operated the equipment and found it to be satisfactory.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] <u>Working Satisfactory</u>						
Customer's Signature	Customer's Remarks					
<i>S. Sengupta</i> 28/05/18	100L + 68 grade Hydraulic oil supplied by municipality					
Service Engineer's Signature	Warranty Claim No.				Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						




COOPERS CAMP MUNICIPALITY
THE CHAIRMAN
CHASSIS NO:
MAT373018G2D09846

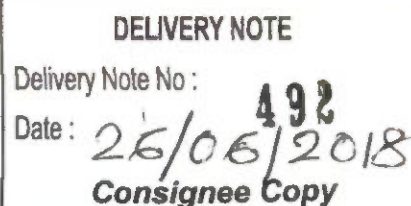
By HAND

Receive the above in good condition

B. J. ...
Inspector & Registrar
(Receiver's Signature)
9/7/78
Date :
Cooper's Camp Northwood ...

2018/06/18




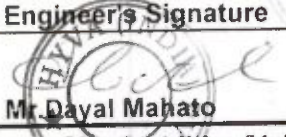


THE CHAIRMAN
RATPUR-SONARPUR
MUNICIPALITY
CHASSI S.NO.
MAT373352G2B02757

Made of Transport :
By HAND

Received
Old Pump Van Double

Date :

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1RAJP025	SERVICE REPORT				Date : 26.06.2018	
Visited By	From Date Time		To Date Time		Call Log No.	HIPL/KOL/2017/SR/DM/800
Mr. Dayal Mahato					Chassis Nos.	MAT373352G2B02757
Customer' Address	Site Address				Body Sl. No.	03VHPC01-029
Rajpur-Sonarpur Municipality, 27, N.S.Road, P.O. Harinavi, P.S. Sonarpur, South 24 Parganas	Rajpur-Sonarpur Municipality, 27, N.S.Road, P.O. Harinavi, P.S. Sonarpur, South 24 Parganas				Model/	RCV 1314
					Delivery Date	21-03-2016
					Failure Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Hydraulic system not working. After inspection found the system pressure was very low.						
Job Done & Recommendation						
Replace the full main pump vane double under part no. 57GC981975. 1no. , Return line filter under part no. 14896991A. 1no. And breather element under part no. 08102117. 1no.with a new one and found the hydraulic system working satisfactorily.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						





Hyva (India) Pvt. Ltd.



22CONT088

SERVICE REPORT

Date : 05/06/18

Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-508
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	NAT3733529205913
Customer' Address	Site Address				Body Sl. No.	03VHPC01-058
					Model/	RCV1314
Contai Municipality Purba Medinipur	Contai Municipality Purba Medinipur				Delivery Date	29/04/2016
					Failure Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Leakage Hose						
Job Done & Recommendation						
Replaced Hose - 02 pcs. Part No - 579C981819 and 579C981820						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						


Annexure III


Signature
05/06/18
Dept.-In-Charge,
Conservancy
Contai Municipality.

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: 22HAL-0089		SERVICE REPORT			Date: 09/06/18	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-500
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373352G2C07047
Customer's Address	Site Address				Body Sl. No.	04VHPC01-092
					Model/	RCV1314
Haldia Municipality Punba Medinipur	Haldia Municipality Punba Medinipur.				Delivery Date	30/04/2016.
					Failure Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Damage Hose.						
Job Done & Recommendation						
Replace 1. Hose PNR no - 5746982720 - 02 pcs.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						



HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: 22BURD115	SERVICE REPORT				Date : 08/06/2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S- 514
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MHT37301842D08728
Customer's Address	Site Address				Body Sl. No.	04VHPC01-112
					Model/	RCV1314
Burdwan Municipality (Burdwan)	Burdwan Municipality (Burdwan)				Delivery Date	27/04/2016
					Failure Date	08/06/2018
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
HOSE LEAKAGE						
Job Done & Recommendation						
Replaced hose 574C982720 - 02 Mts.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

22QR/09/03	Hyva (India) Pvt. Ltd.					
Code: 22BURD116	SERVICE REPORT				Date : 08/06/2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-515
	Date	Time	Date	Time	Chassis Nos.	W1173730180200822
Mr. Dayal Mahato					Body Sl. No.	04VHPC01-113
Customer' Address	Site Address				Model/	RCV1314
Burdwan Municipality (Burdwan)	Burdwan Municipality (Burdwan)				Delivery Date	27/04/16
					Failure Date	08/06/2018
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
HOSE LEAKAGE						
Job Done & Recommendation						
Replaced hose 5742982720 - 01/21-						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						



HIPL/QR/09/03	Hyva (India) Pvt. Ltd.				HYVA	
Code: 21 PANI013	SERVICE REPORT				Date : 13/06/2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-S18
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2A02431
Mr. Dayal Mahato					Body Sl. No.	03VHPC01-017
Customer' Address	Site Address				Model/	RCV1314
Panikhat Municipality (N 241st Pargana)	Panikhat Municipality (N 241st Pargana)				Delivery Date	28/03/2016
Type of Visit	Type of Job				Failure Date	
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Damage fabrication Torque Tube.						
Job Done & Recommendation						
Replaced. by fresh new fabrication Torque Tube - dpc. Part no - 57GE98A543						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						



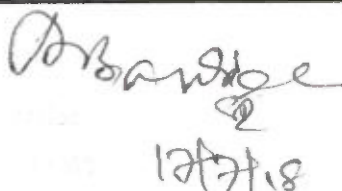
HIPL/QR/09/03	Hyva (India) Pvt. Ltd.				HYVA	
Code: ZIPAN1013	SERVICE REPORT				Date: 20/06/18	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-524
Mr. Dayal Mahato	Date	Time	Date	Time	Chassis Nos.	MAT373352Q2A 02431
Customer's Address	Site Address				Body Sl. No.	03VHPC01-017
Panikoti Municipality.	Panikoti Municipality. North 24 Parganas -				Model/	RCV1314
Type of Visit	Type of Job				Delivery Date	28/03/16
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Binding hose disconnected.						
Job Done & Recommendation						
1st - Binding hose Change. Part No - 574C982724						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						


Annexure III



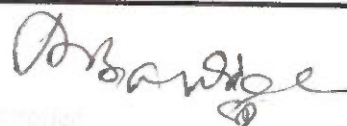


HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code:Z2BELD141	SERVICE REPORT				Date : 19.06.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-520
	Date	Time	Date	Time		
Mr. Dayal Mahato	23-6-18	1:30 pm	23-6-18	2:00 pm	Chassis Nos.	MAT373018G2D09126
Customer' Address	Site Address				Body Sl. No.	04VHPC01-124
					Model/	RCV1314
Beldanga Municipality (Murshdabad)	Beldanga Municipality (Murshdabad)				Delivery Date	09.05.2016
					Failure Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Fault found at Hose						
Job Done & Recommendation						
Replaced new Hose (Part no - 57GC982724) - 02 pc.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Anil Kumar Singh Inspector-in-charge			Hose change done.			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						




QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1SREE068	SERVICE REPORT				21.06.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-522
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373352G2C07728
Customer' Address	Site Address				Body Sl. No.	04VHPC01-099
					Model/	RCV1314
Serampore Municipality (Hooghly)	Serampore Municipality (Hooghly)				Delivery Date	26-04-2016
					Failure Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Fabrication Torque tube bend and damage						
Job Done & Recommendation						
Replaced new (Part no - 57GC98A543) - 1pcs						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

Annexure III


Anuj Bhatnagar
Sanjay 12/7/18

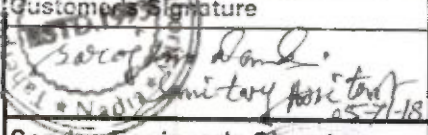


HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1CHAN027	SERVICE REPORT				23.06.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-524
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2B02819
Mr. Dayal Mahato					Body Sl. No.	03VHPC01-023
Customer' Address	Site Address				Model/	RCV1314
Chandannagar Municipal Corporation (Hooghly)	Chandannagar Municipal Corporation (Hooghly)				Delivery Date	27-03-2016
					Failure Date	
Type of Visit		Type of Job				
[1] On Call [2] On Own		[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign				
Nature of Complaints & Failure Analysis						
Eject valv to PTO pump hose Lickage						
Job Done & Recommendation						
Replaced new Hose (Part no - 57GC981819) - 1pcs						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
			 			
Service Engineer's Signature			Warranty Claim No.		Offer No. / Proforma Invoice No.	
 Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						

PARTS INVOICING TO BE RAISED FOR THE QUARTER JUL'18 TO SEP'18 AS PER THE FOLLOWING DETAILS:

SL. NO.	ULB NAME	CHASSIS NO.	PROJECT CODE	PART NO.	DESCRIPTION	QTY.	DELIVERY NOTE
1	Taherpur Municipality	MAT373018G2D09841	Z1TAHE178	56211172	Ejector Cylinder	1	495
				57GC983197	Mini/Mega/Midium Valve	1	
2	Barasat Municipality	MAT373352G2C07363	Z1BARA046	56211172	Ejector Cylinder	1	496
				57GC982724	Hose	1	531
				57GC982725	Hose	1	258
				5603200306	Rear Door Rubber	7	688
3	Baranagar Municipality	MAT373352G2C05916	Z1BRAN043	56211172	Ejector Cylinder	1	
				57GC983197	Mini/Mega/Midium Valve	1	696
				57GC702HF32	Adaptor	1	
				56287267	Adaptor	1	
				14896991A	Return Line Filter Element	1	
				8102117	Breather Element	1	699
				56245529	Loading Valve	1	
4	South Dum Dum Municipality	MAT373352G2A02379	Z1SDUM011	57GC983431	Binlift Valve	1	547
5	South Dum Dum Municipality	MAT373352G2A02369	Z1SDUM010	57GC982724	Hose	1	661
6	North Barrackpore Municipality	MAT373352G2C06919	Z1NOBA054	57GC983431	Binlift Valve	1	667
				5603200306	Rear Door Rubber	7	
7	North Barrackpore	MAT373352G2C06924	Z1NOBA055	5603200306	Rear Door Rubber	7	265
				57GC983431	Binlift Valve	1	
8	Panihati Municipality	MAT373352G2A02430	Z1PANI012	5737680005	Solenoid Coil & Connector	1	669
				5603200306	Rear Door Rubber	7	
				57GC982725	Hose	1	680
9	Panihati	MAT373352G2A02431	Z1PANI013	5603200306	Rear Door Rubber	7	670
				57GC982724	Hose	1	270
10	Bongaon	MAT373018G2D10038	Z1BONG020	57GC983197	Mini/Mega/Midium Valve	1	
				56211172	Ejector Cylinder	1	
				57GC981975	Pump Vane Double	1	671
				56245529	Loading Valve	1	
				5603200306	Rear Door Rubber	7	
				57GC982724	Hose	1	698
11	Naihati	MAT373018G2D09782	Z1NAIH173	57GC981819	Hose	1	532
12	Naihati	MAT373018G2D09838	Z1NAIH174	5603200306	Rear Door Rubber	7	275
				57GC98A543	Fabrication Torque Tube	1	
13	Khragpur	MAT373352G2C07048	Z2KHAR086	57GC981819	Hose	1	538
14	Uttarpara	MAT373352G2B02828	Z1UTTA031	57GC981819	Hose	1	539
15	Rajpur Sonarpur	MAT373352G2B02757	Z1RAJP025	57GC981819	Hose	1	542
16	Purulia	MAT373352G2C06528	Z2PURU081	57GC981819	Hose	1	543
				57GC982724	Hose	1	
17	Purulia	MAT373352G2C06546	Z2PURU082	57GC982725	Hose	1	692


Handwritten signature


HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1TAHE178	SERVICE REPORT				Date : 05.07.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/801
	Date	Time	Date	Time		
Mr. Dayal Mahato					Chassis Nos.	MAT373018G2D09841
Customer's Address	Site Address				Body Sl. No.	05VHPC01-179
					Model/	RCV 1314
Taherpur Municipality, P.O.-Taherpur Bazar, Dist.- Nadia, Pin: 741159	Taherpur Municipality, P.O.-Taherpur Bazar, Dist.- Nadia, Pin: 741159				Delivery Date	16-05-2016
					Failure Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Ejector cylinder not functioning. After inspection found that the hydraulic pressure was not increasing to 220bar.						
Job Done & Recommendation						
Changed the Ejector Cylinder under part no. 56211172 and Mini/Mega/Medium Valve with new one under part no. 57GC983197 and found the ejector working and the pressure increasing to 22bar.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Dayal Mahato Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
OLD EJECTOR CYLINDER NOT RETURNED. IT STAYED AT MUNICIPALITY						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						


Obt. 11.5.2018
Annexure III





HIPL/QR/09/03	Hyva (India) Pvt. Ltd.				HYVA	
Code: 21BARA046	SERVICE REPORT				Date : 07/07/2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-531
Mr. Dayal Mahato	Date	Time	Date	Time	Chassis Nos.	MAF3733529267363
Customer's Address	Site Address				Body Sl. No.	
BARASAT MUNICIPALITY (N) 24W PRGS	BARASAT MUNICIPALITY (N) 24W PRGS.				Model/	RCV1314
Type of Visit	Type of Job				Delivery Date	
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign				Service Date	07/07/2018
Nature of Complaints & Failure Analysis						
fault in hose.						
Job Done & Recommendation						
Replaced new hose - 41m (Part no 574698272A)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato			1869			
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

 As per the (WAREHOUSE IN-CHARGE) DATE: 08/09/2018	GSTN: 19AAACH2006C PAN: AAACH2006C	Receive the above in good condition  (RECEIVER'S SIGNATURE) DATE: 08/09/2018
--	---	---


HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BARA046	SERVICE REPORT				06.09.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-258
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2C07363
					Body Sl. No.	04VHPC01-075
Customer' Address	Site Address				Model/	RCV1314
Barasat Municipality	Barasat Municipality				Delivery Date	15.03.2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Binlifting Hose Damage.						
Job Done & Recommendation						
Replace New Hose - 1pc (part number 57GC982725).						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature				Customer's Remarks		
						
Service Engineer's Signature		Warranty Claim No.		Offer No./Proforma Invoice No.		
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



L/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BRAN043	SERVICE REPORT				24.08.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-688
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2C05916
					Body Sl. No.	03VHPC01-053
Customer Address	Site Address				Model/	RCV1314
Baranagar Municipality	Baranagar Municipality				Delivery Date	11.04.2016
					Failure Date	
Type of Visit		Type of Job				
[1] On Call [2] On Own		[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign				
Nature of Complaints & Failure Analysis						
Damage REAR DOOR SEALING RUBBER.						
Job Done & Recommendation						
Replace REAR DOOR SEALING RUBBER - 01 pc, part number 5603200306.						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature				Customer's Remarks		
						
Service Engineer's Signature		Warranty Claim No.		Offer No./Proforma Invoice No.		
 Mr. Dayar Mahato						
Remarks on the Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						




HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BRAN043	SERVICE REPORT				28.08.2018	
Visited By	From Date Time		To Date Time		Call Log No.	HIPL/KOL/2018/SR/DM/S-696
					Chassis Nos.	MAT373352G2C05916
					Body Sl. No.	03VHPC01-053
Customer' Address	Site Address				Model/	RCV1314
Baranagar Municipality	Baranagar Municipality				Delivery Date	11.04.2018
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Defect found from Ejecter Cylinder , Ejector Valve , and Adaptor .						
Job Done & Recommendation						
New replace Ejecter valve - 1pc (part number 57GC983197) , Ejector cylinder - 1pc (part number 56211172) , Adaptor - 01pc (part number 57GC702HF32) and Adaptor - 01pc (Part number 56287267)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution 1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1BRAN043	SERVICE REPORT				Date : 01.09.2017	
Visited By	From		To		Call Log No.	HIPL/KOL/2017/SR/DM/S-699
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2C05916
Mr. Dayal Mahato					Body Sl. No.	03VHPC01-053
Customer' Address	Site Address				Model/	RCV 1314
Baranagar Municipality, 87, Deshbandhu Road, P O Alambazar, 24 Parganas (N), Kolkata- 700 035	Baranagar Municipality, 87, Deshbandhu Road, P.O. Alambazar, 24 Parganas (N), Kolkata- 700 035				Delivery Date	11-04-2016
					Service Date	
Type of Visit		Type of Job				
[1] On Call [2] On Own		[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign				
Nature of Complaints & Failure Analysis						
Fault in Loading Valve						
Job Done & Recommendation						
Given hydraulic oil , replaced Return line filter (part no. 14896991A) - 1pc, Breather filter (part no. 08102117) - 1pc. and Loading Valve (part no - 56245529) - 1pc .						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
						
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Mr. Dayal Mahato						
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						

HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1SDUM011	SERVICE REPORT				26.07.2018	
Visited By	From		To		Call Log No.	HIPL/KOL/2018/SR/DM/S-547
	Date	Time	Date	Time	Chassis Nos.	MAT373352G2A02379
Customer' Address	Site Address				Body Sl. No.	02VHPC01-008
South Dum Dum Municipality	South Dum Dum Municipality				Model/	RCV1314
					Delivery Date	05-03-2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own	[1] Commissioning [2] Warranty [3] Chargeable [4] Campaign					
Nature of Complaints & Failure Analysis						
Fault arise from Binlift cylinder and Binlift valv.						
Job Done & Recommendation						
Replaced Binlift valv -01 pc (part number 57GC983431), Binlift Clinder - 02 pc (part number 57GC980019)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature			Customer's Remarks			
Service Engineer's Signature			Warranty Claim No.		Offer No./Proforma Invoice No.	
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
old maintenance received 30/7/18						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						



HIPL/QR/09/03	Hyva (India) Pvt. Ltd.					
Code: Z1SDUM010	SERVICE REPORT				06.08.2018	
Visited By	From Date Time		To Date Time		Call Log No.	HIPL/KOL/2018/SR/DM/S-661
					Chassis Nos.	MAT373352G2A02369
					Body Sl. No.	02VHPC01-009
Customer's Address	Site Address				Model/	RCV1314
South Dum Dum Municipality	South Dum Dum Municipality				Delivery Date	04.03.2016
					Service Date	
Type of Visit	Type of Job					
[1] On Call [2] On Own [1] Commissioning [2] Warranty [3] Chargeable [4] Campaign						
Nature of Complaints & Failure Analysis						
Defect found from Binlifting Hose . 2 RS 30 Braiding Broken .						
Job Done & Recommendation						
Binlifting Hose new replace - 1pc (Part number 57GC982724) , 2 RS 30 Braiding - 02/4 Replaced . (5731120018)						
Status of Vehicle after visit						
[1] Break Down [2] Working with Defect [3] Working Satisfactory						
Customer's Signature				Customer's Remarks		
						
Service Engineer's Signature				Warranty Claim No.	Offer No./Proforma Invoice No.	
Remarks on Site Condition/Vehicle Operation/Maintenance Practices/Loading Practices						
Copy Distribution						
1st Copy : Customer 2nd Copy : Hyva-Area Manager 3rd Copy : Service Engg 4th Copy : Dealer						
Annexure III						